

Touch Driver Install Manual SPT-4500

(Version 2.0)

www.sam4s.com

Revision A (Apr 9, 2012)



Contents

1.	Windows XP	3
	(1) Installation of Touch Driver	3
2.	Windows 7	13
	(1) Installation of Touch Driver	13



- 1. Windows XP
- (1) Installation of Touch Driver
- ① Run 'Setup.exe' file.




2 After install wizard starting, click 'Next' button.






3 Agree with license. Click 'I Agree' button.

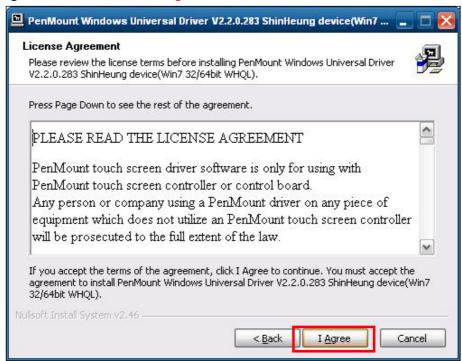


④ You can select 'Destination Folder' on a 'Choose Install Location' dialog. If you don't want to change, click 'Install' button.

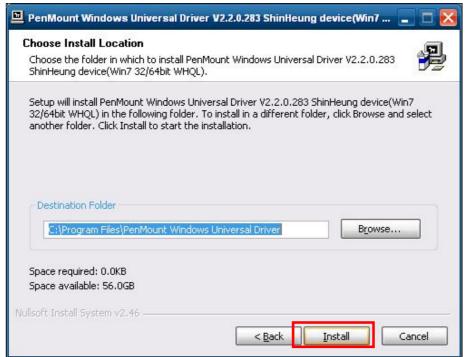



⑤ After completing setup wizard, Click 'Finish' button.

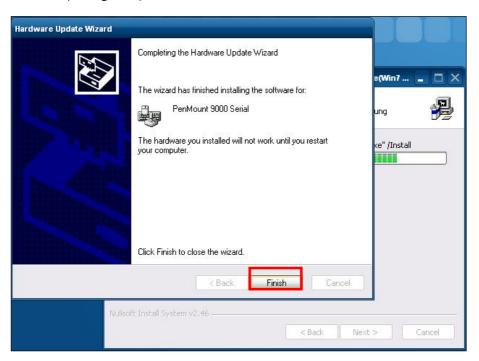


6 Click 'Finish' button. System will be restarted.






⑦ Click the right button of mouse on 'PM' icon of Windows tray icons. And select 'Control Panel' on popup menu.



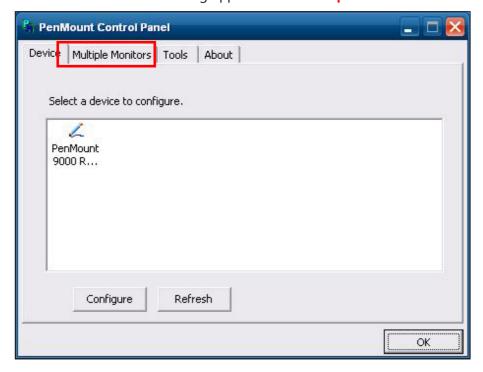




(9) Uncheck 'Multiple Monitor Support' box on 'Multiple Monitors' tab.

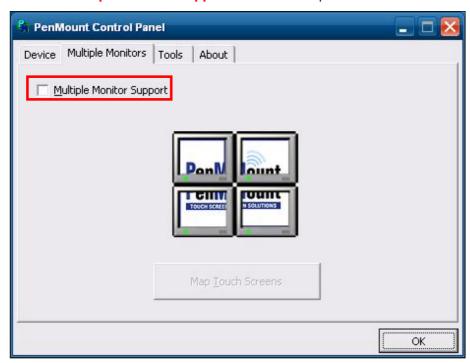

Double-click 'PenMount 9000 RS232' on 'Device' tab.

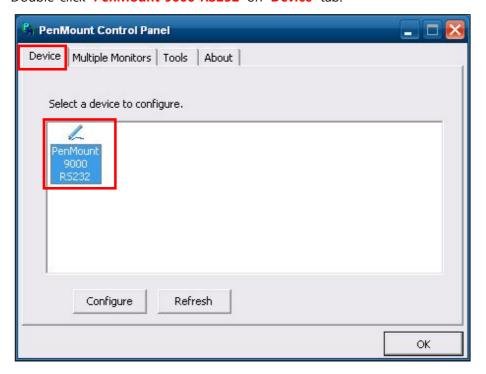




① Click 'Edge Compensation' tab.




12 Move the four scroll bars to the left.

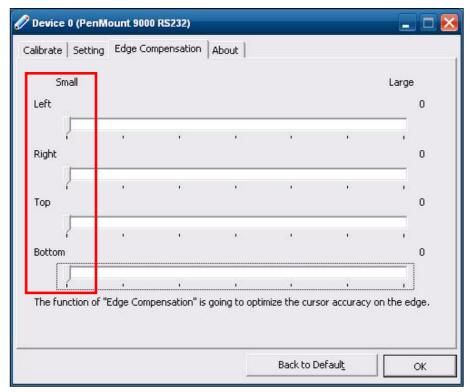




① Click 'Setting' tab.

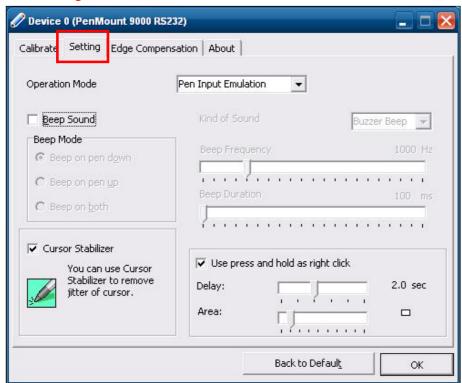


(4) Click 'Back to Default' button and check 'Beep Sound' button.

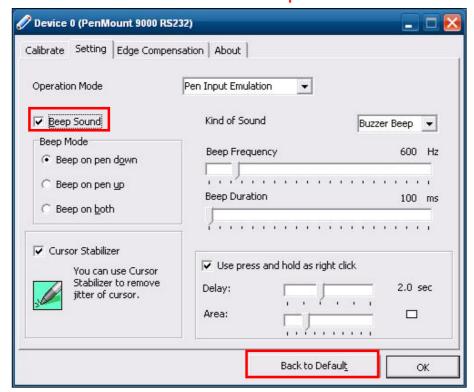




(5) On 'Calibrate' tab, select the number '25' of Advanced Mode combo-box list if it is possible. And then click the 'Advanced Calibration' button.

(The number of box is higher and higher, calibration will be more accurate.)

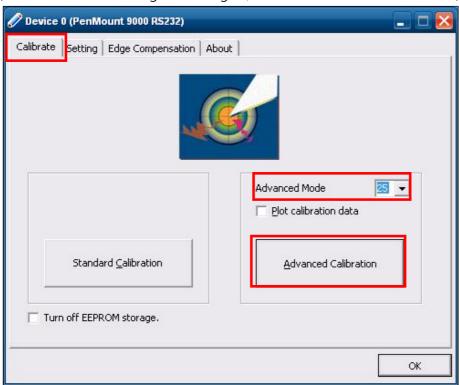


16 Uncheck 'Turn off EEPROM storage' button.

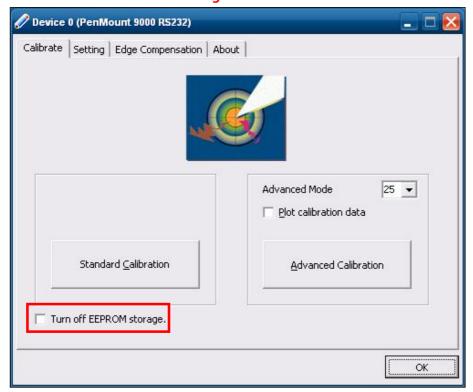




17 Click the red point about 2 seconds on a calibration screen. Calibration procedure will be proceeded with following messages.

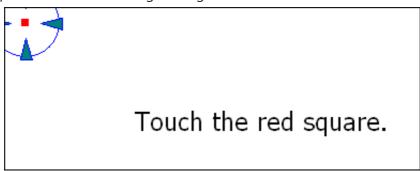


18 Click 'Ok' button.

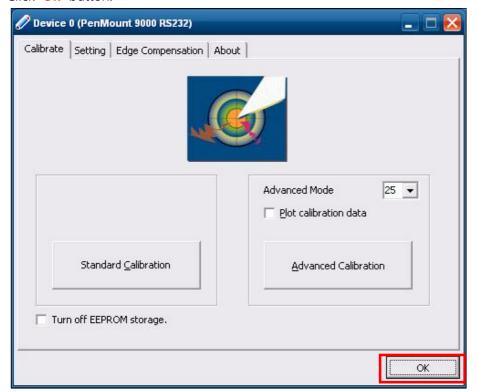




19 Click 'OK' button.

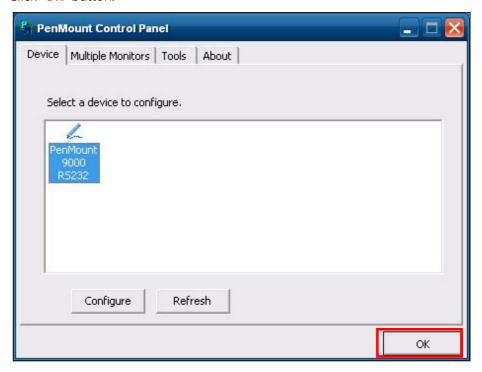




- 2. Windows 7
- (1) Installation of Touch Driver
- ① Run 'Setup.exe' file.




2 Click 'Yes' button when UAC dialog appeared.

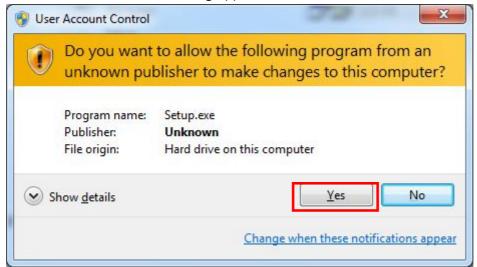




3 After install wizard starting, click 'Next' button.

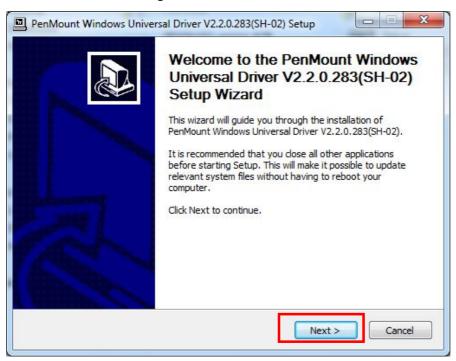


4 Agree with license. Click 'I Agree' button.

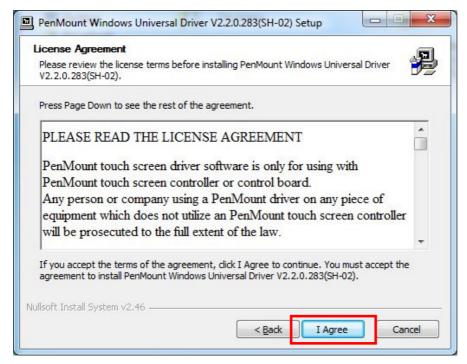




§ You can select 'Destination Folder' on a 'Choose Install Location' dialog. If you don't want to change, click 'Install' button.

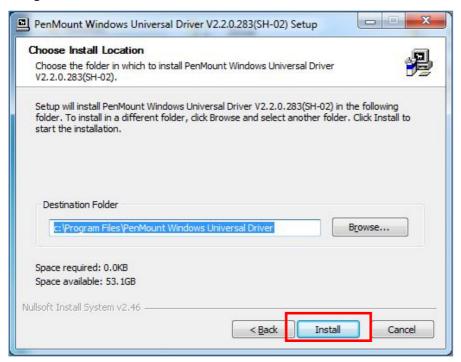

6 After completing setup wizard, Click 'Finish' button.

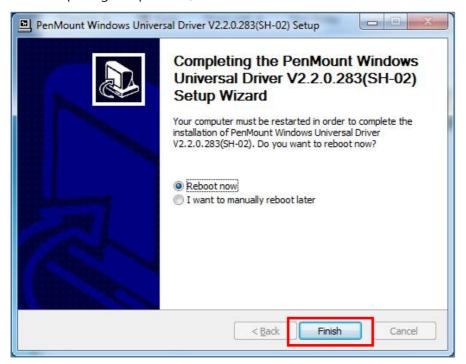




⑦ Click the right button of mouse on 'PM' icon of Windows tray icons. And select 'Control Panel' on popup menu.








(9) Uncheck 'Multiple Monitor Support' box on 'Multiple Monitors' tab.

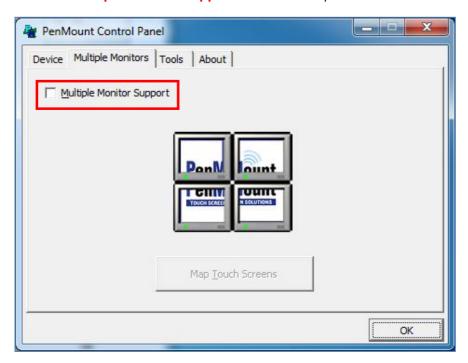

10 Double-click 'PenMount 9000 RS232' on 'Device' tab.

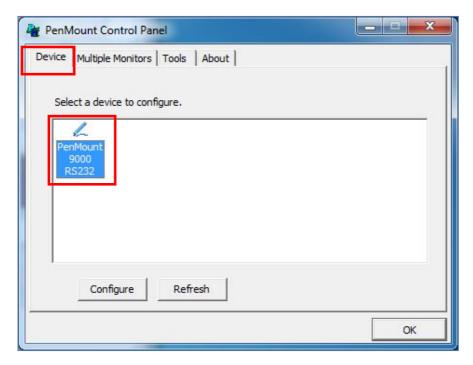




① Click 'Edge Compensation' tab.




12 Move the four scroll bars to the left.

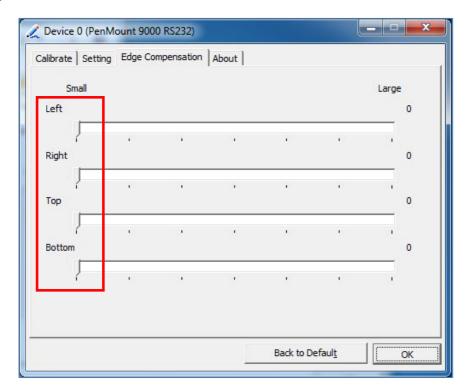




③ Click 'Setting' tab.

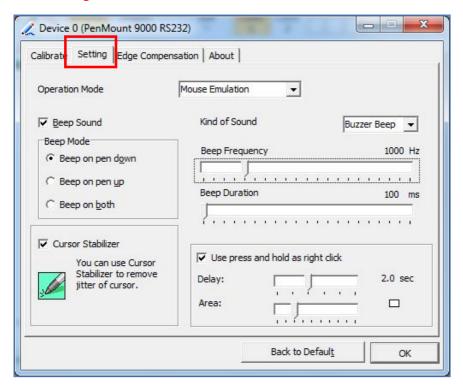


(4) Click 'Back to Default' button and check 'Beep Sound' button.

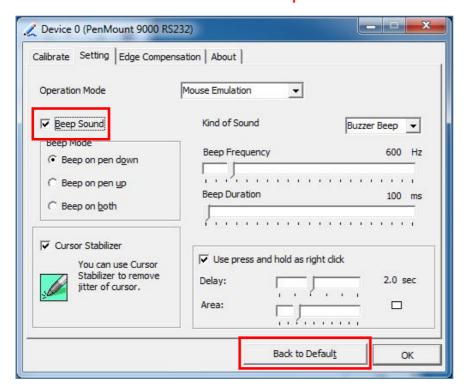




⑤ On 'Calibrate' tab, uncheck 'Turn off EEPROM storage' button

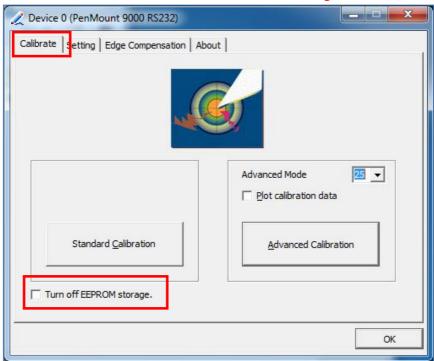

16 select the number '25' of Advanced Mode combo-box list if it is possible. And then click the 'Advanced Calibration' button.

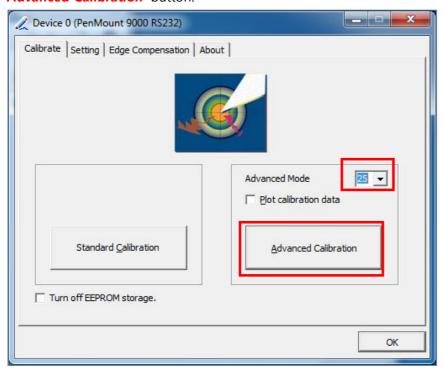




17 Click the red point about 2 seconds on a calibration screen. Calibration procedure will be proceeded with following messages.



18 Click 'Ok' button.

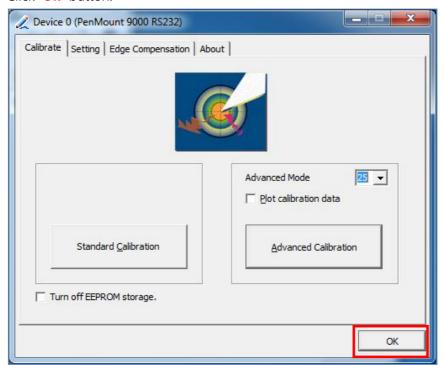



20 Click 'OK' button.

